



WEEKLY INCIDENT SUMMARY

Week ending Friday 30 October 2020

This incident summary provides information on reportable incidents and safety advice for the NSW mining industry. To report an incident to the NSW Resources Regulator: phone 1300 814 609 24 hours a day, 7 days a week.

At a glance

High level summary of emerging trends and our recommendations to operators.

| ТҮРЕ | NUMBER |
|---------------------------|--------|
| Reportable incident total | 40 |
| Summarised incident total | 2 |

Summarised incidents

INCIDENT TYPE SUMMARY COMMENTS TO INDUSTRY An operator was knocked to the ground Tyres should be checked and Dangerous incident when a tyre on a fuel truck blew out. The repaired in accordance with IncNot0038535 operator was on the opposite side of the AS 4457.2-2008 Earth-moving Mineral sands truck to where the tyre blew and was machinery - Off-the-road wheels, dredging knocked off their feet following the rims and tyres - Maintenance and incident. The truck was unladen and repair – Tyres. stationary at the time and had only The life cycle management of travelled 100m from the workshop when tyres should include the the incident occurred. changing out of the tyre before failure. Tyre manufacturers should be engaged to assist with identifying the cause of tyre failure. Regular visual inspections of

tyre sidewalls should be done



- to identify bulges, bubbles, cuts or other damage to minimise risk from tyre failure or blowouts.
- Vehicles should not be operated with underinflated tyres.

Dangerous incident IncNot0038559
Open cut coal mine

open cut coal mille

Fire or explosion

A fuel cart was refuelling a drill rig when a cracked fuel tank sprayed diesel onto the drill rig turbo causing a fire.





Refuelling arrangements for mobile plant should be risk assessed and managed for all mine sites. The potential risk of plant/worker interaction and fire should be controlled.

Mines should check the designs of fuel tanks to ensure they are capable of accepting high delivery flows and can handle the pressure of the refuelling system without deformation of the fuel tank including the maintenance of pressure relief valves.

Other publications of interest

The incidents are included for your review. The NSW Resources Regulator does not endorse the findings or recommendations of these incidents. It is your legal duty to exercise due diligence to ensure the business complies with its work health and safety obligations.



| PUBLICATION | ISSUE/TOPIC |
|--|---|
| | International (fatal) |
| MSHA | Mine Fatality – A leading hand was killed, when his light vehicle was hit by a haul truck. Details |
| | International (other, non-fatal) |
| MinEx NZ | Fire destroys loader – A loader operator noticed smoke while in the cab of a loader. Looking behind him, he saw flames behind the cab. Details |
| | National (fatal) |
| Queensland Coal Mines Inspectorate | September 2020 Incident Periodical Details |

Note: While the majority of incidents are reported and recorded within a week of the event, some are notified outside this time period. The incidents in this report therefore have not necessarily occurred in a one-week period. All newly recorded incidents, whatever the incident date, are reviewed by the Chief Inspector and senior staff each week. For more comprehensive statistical data refer to our annual performance measures reports.

© State of New South Wales through Regional NSW 2020 You may copy, distribute, display, download and otherwise freely deal with this publication for any purpose, provided that you attribute Regional NSW as the owner. However, you must obtain permission if you wish to charge others for access to the publication (other than at cost); include the publication in advertising or a product for sale; modify the publication; or republish the publication on a website. You may freely link to the publication on a departmental website.

Disclaimer: The information contained in this publication is based on knowledge and understanding at the time of writing (November 2020) and may not be accurate, current or complete. The State of New South Wales (including Regional NSW), the author and the publisher take no responsibility, and will accept no liability, for the accuracy, currency, reliability or correctness of any information included in the document (including material provided by third parties). Readers should make their own inquiries and rely on their own advice when making decisions related to material contained in this publication.

| DOCUMENT CONTROL | |
|-----------------------|---|
| CM9 reference | DOC20/916857 |
| Mine safety reference | ISR20-44 |
| Date published | 06 November 2020 |
| Approved by | Chief Inspector Office of the Chief Inspector |